



REPAIR FOR...

Alternator

Application for:


Ford Fiesta VI 2008,
Ford Mondeo IV 2010,
Ford Focus III, 2010

Part numbers

440135, 406755, 439612,
449612, 446755, 200207
Tech Code: TG12C087

Reasons of alternator lamp illumination (Technical reference: TG12C087)

Model car	Fault reason	Resulting
Ford Fiesta VI 2008	Broken temperature sensor based on which the charging current is selected by ECU	
Ford Mondeo IV 2010	Tarnished/damaged contacts prevent proper operation of the on-board equipment and the alternator	This fault can immobilize the car
Ford Focus III 2010	Damaged wires about 10 cm from the alternator plug	Sometimes it happens that the controller is damaged (PWM signal disrupted)

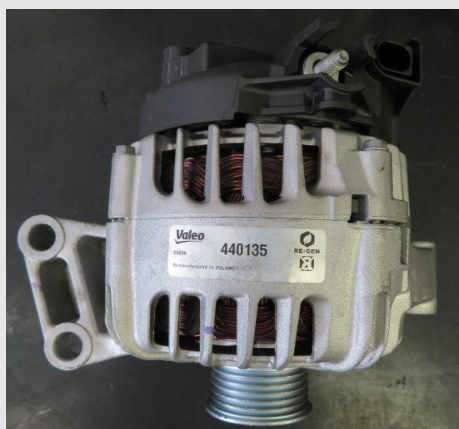

Website
valeoservice.us/en-us



Technical Assistance
1-888-718-2536

valeoservice.us 